



## Autocar Parts Special Update

---

PARTS BULLETIN

DECEMBER 4 2007

---

IN THIS ISSUE:

### FAN RING SEALS

Autocar Service Warranty Department is running Service Program number SP 2-201-001 regarding incorrect installations of fan ring seals; Parts Department is posting this bulletin to ensure proper change-out of seal in the field.

1. INCORRECT FAN RING SEAL INSTALLED IN CERTAIN AUTOCAR WX AND WXLL MODEL VEHICLES BUILT BETWEEN **29 JANUARY 2007** AND **12 NOVEMBER 2007**, VIN RANGE **205322** TO **206636**

ONLY WX AND WXLL VEHICLES EQUIPPED WITH 2007 EPA-COMPLIANT EMISSIONS SYSTEMS ARE AFFECTED.

THE DETERMINING FACTOR FOR SELECTING CORRECT FAN RING SEAL IS THE MATERIAL OF THE FAN RING. THOSE BUILT WITH AN ALUMINUM RING REQUIRE PART NUMBER **1676604**. THOSE BUILT WITH A FIBERGLASS RING REQUIRE **A2010135-001**.

THE PARTS ARE **NOT INTERCHANGEABLE** BECAUSE THE NEWER FIBERGLASS RING IS 2 INCHES SMALLER IN DIAMETER THAN THE ALUMINUM RING.